Water in Fuel Display on Blue Bird Vision Tech Tip #19-1207



WIF



Water in fuel

There is a "Water in Fuel" Message on the INFO Center of the Dash

Recently with the onset of the North East weather conditions, we have had issues where drivers are seeing messages on the "INFO" Center of the dash or in some cases Check Engine Lights(CEL). When a CEL is present we have found code #0418 active which is "Water In Fuel (WIF) indicator High.

Upon going through the diagnostic steps, we found nothing that would have caused the light, but the code remained active and could not be cleared.

We continued to investigate.....several years ago we had standardized to use option #40233-14 which changes location of the fuel/water separator mounting from being mounted on the frame over the rear axle to being mounted on the Driver Control Module (Firewall). The electrical harness is the same for both applications and when this option is ordered we recommend to install a plastic "cap" over the connector plug #C735 at the rear to prevent water infiltration. Please see Figures #1-#3











FIGURE #1

FIGURE #2



FIGURE #3

ALL of our Service Updates can be found on the New York Bus Sales website Or at the New York Head Mechanic website







2

Once you determine this to be an issue, clean the connector on the unit and verify by clearing the code that the issue has been resolved.

There is a 2-pin "mating connector", part #00008461 (Figure #4) and 2 "sealing plugs", part # 01891647 (Figure #5) which should be installed to protect against future contamination.

Connect the "Mating Connector" to the plug and install the "Sealing Plugs" as shown in Figure #6



Figure #4



Figure #5









Step 1: Holding the sealing plug with large diameter end away from the connector, gently apply downward pressure to force the sealing plug into the cavity.



Step 2: With perpendicular motion, apply downward pressure to the large diameter end of the sealing plug.



Step 3: Apply pressure until sealing plug is forced to stop by contact with rear grommet. Visually inspect the sealing plug to confirm it is flush with cavity opening.

Figure #6







CONTACT OUR SERVICE OR PARTS DEPARTMENT WITH ANY QUESTIONS

SERVICE

Chittenango: 800-962-5768

Daryl Wallace

Rochester: 800-463-3232

Eric Bosley

Albany: 866-867-1100

Ben Reiling

Lower Hudson Valley Region:

845-609-7070

Customer Support

Representatives

Eastern Region:

Gary Bigness 845-500-3707

Central Region:

Call Service

TBD

Western Region:

Call Service

TBD

Comments or Concerns:

John Johnston

jjohnston@newyorkbussales.com

Cell 315-263-0766

PARTS

Director of Parts

Jim Hogan

jhogan@newyorkbussales.com

607-227-5794

Chittenango: 800-962-5768

Gari McQuade

gmcquade@newyorkbussales.com

Bill Cox

bcox@newyorkbussales.com

John Lewin

jlewin@newyorkbussales.com

Dave Grant

dgrant@newvorkbussales.com

Albany: 866-867-1100

Sean Conway

sconway@newyorkbussales.com

Dan Haight

dhaight@newyorkbussales.com

Rochester: 800-463-3232

Steve Hibbard

shibbard@newyorkbussales.com

James Roeser

jroeser@newyorkbussales.com





