
Cummins Fault Code 559 Engine Tech Tip #19-0226



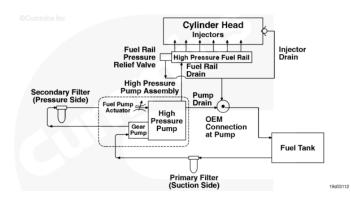

Fuel Rail Pressure Code May NOT Mean a New Pump is Required

We know that the engine runs high fuel pressure, and the ECM monitors that pressure to maintain efficiency. One fault code we have seen is #559 and in troubleshooting we have replaced sensors and/or pumps as directed by Cummins only to find that they were not the cause.

After researching what was found was that the unit was starving for fuel. We then started at the tank and worked our way forward to see where the issue was and nothing stuck out immediately so we dug deeper

We finally found that when the plastic loom covering the rubber fuel line (Blue Bird changed from the brown Synflex line to rubber) was pulled away where it comes up to the fuel/water separator mounted on the fire wall that the hose was kinked causing a restriction. Please see Figure #1.

ALL of our Service Updates can be found on the New York Bus Sales website

Or at the New York Head Mechanic website









Figure #1

Removing the line and shortening to reduce the angle opened the hose up but as a precaution in some cases a section of Synflex was slipped into the rubber line to ensure the kink would not return.

ALL of our Service Updates can be found on the New York Bus Sales website

Or at the New York Head Mechanic website







CONTACT OUR SERVICE OR PARTS DEPARTMENT WITH ANY QUESTIONS

SERVICE

Chittenango: 800-962-5768 Daryl Wallace or Brian Lamaitis

Rochester: 800-463-3232

Albany: 866-867-1100

Ben Reiling

Warranty: 800-962-5768

Morgan Jenkins

Customer Service

Representatives

Eastern Region:

Gary Bigness 845-500-3707

Central Region:

Josh Coon 315-263.0765

Western Region:

Mike Panzica 716-908-3186

Jim Hogan jhogan@newyorkbussales.com 607-227-5794

Chittenango: 800-962-5768

Gari McQuade

gmcquade@newyorkbussales.com

Bill Cox

bcox@newyorkbussales.com

John Lewin

ilewin@newyorkbussales.com

Dave Grant

dgrant@newyorkbussales.com

Albany: 866-867-1100

Sean Conway

sconway@newyorkbussales.com

John Green

jgreen@newyorkbussales.com

Rochester: 800-463-3232

Tim Gross

tgross@newyorkbussales.com

Steve Hibbard

shibbard@newyorkbussales.com

ALL of our Service Updates can be found on the New York Bus Sales website

Or at the New York Head Mechanic website





