
## Blue Bird Vision/Ford Transmission Tail Shaft Mount Tech Tip #17-0706-RP

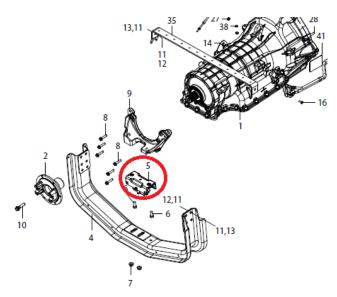

## **Transmission Tail Shaft Mount Issue**

It's come to our attention that there are units experiencing a "thumping" noise when shifting. The rear mount (BB Part #10043517) for the tail shaft, circled in red on the drawing above and shown in Figure #1, had become worn causing the issue. A simple check can be done using a pry bar, as illustrated in Figure #2. There should be "slight" (About 1/8" to ½") of play. What was found on units where the issue occurred was that the cross bolt was rubbing into the metal (Figures #3 & 4). Removing the cross bolt and putting a piece of rubber hose over the shaft of the bolt between the metal will address the issue temporarily until a new mount can be ordered and replaced.







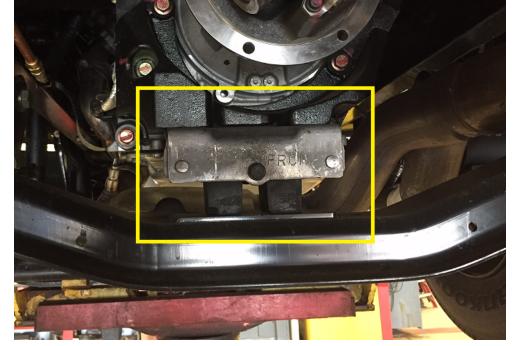


FIGURE #1



FIGURE #2









FIGURE #3



FIGURE #4









FIGURE #5

THANK YOU TO RALPH AND THE GUYS AT WASHINGTONVILLE **CENTRAL SCHOOL FOR POINTING THIS OUT!** 







## CONTACT OUR SERVICE OR PARTS DEPARTMENT WITH ANY QUESTIONS

**SERVICE** 

**Chittenango:** 800-962-5768 Daryl Wallace or Brian Lamaitis

Rochester: 800-463-3232

**Dave Schaub** 

Albany: 866-867-1100

Ben Reiling

Warranty: 800-962-5768

Morgan Jenkins
Customer Service
Representatives

**Eastern Region:** 

Gary Bigness 845-500-3707

**Central Region:** 

JJ Richmond 315-559-3999

**Western Region:** 

Mike Panzica 716-908-3186 **PARTS** 

**Director of Parts** 

Jim Hogan jhogan@newyorkbussales.com 607-227-5794

Chittenango: 800-962-5768

Gari McQuade

gmcquade@newyorkbussales.com

Bill Cox

bcox@newyorkbussales.com

John Lewin

jlewin@newyorkbussales.com

**Dave Grant** 

dgrant@newyorkbussales.com

Albany: 866-867-1100

Sean Conway

sconway@newyorkbussales.com

Pat Murphy

pmurphy@newyorkbussales.com

**Rochester:** 800-463-3232

Dave Cook

dcook@newyorkbussales.com

Steve Hibbard

shibbard@newyorkbussales.com





