

From your friends at New York Bus Sales

## **Product Affected – All American "A3" Units**

Complaint - The defroster fan only works on high, replacing the resistor works for a

short time on all speeds and then fails again. Checking draw and the circuit

does not show an issue.

Cause - Using the improper resistor – There are 2 resistors which are very similar

in appearance and the only way to really tell them apart is that the

improper one (Figure #1) has 2 diodes built into it and is used mainly for

the rear "wall" mounted heater.

Correction - Use the proper resistor (Figure #2) which does NOT have the diodes -



FIGURE #1



## FIGURE #2

Specifics
CORRECT RESISTOR #01601681
IN-CORRECT RESISTOR #00035868

PLEASE NOTE – The resistor with the diodes may be used in an emergency but to help increase the longevity the diodes should be bent down toward the mounting plate and away from the coils ..... this should ONLY be a temporary repair!



THANK YOU TO VIC AND THE GUYS AT CARTHAGE CS FOR POINTING THIS OUT!!!

## Contact Our Service Department With Any Questions

CHITTENANGO – phone 800-962-5768 or Daryl Wallace : <u>dwallace@newyorkbussales.com</u> Brian Lamaitis : <u>blamaitis@newyorkbussales.com</u>

ROCHESTER – phone 800-463-3232 or Gary Chichester: <u>gchichester@newyorkbussales.com</u>

**ALBANY** – phone 866-867-1100 or Ben Reiling: <u>breiling@newyorkbussales.com</u> Steve Searles: <u>ssearles@newyorkbussales.com</u>

WARRANTY – 800-962-5768 ext 237 Morgan Jenkins: mjenkins@newyorkbussales.com