

Blue Bird T3FE Electrical Stud

Complaint – There is an air leak under the dash by the driver's feet -

Cause – In the group of air lines running through the firewall by the driver's feet, one has a hole in it (Figure #1). Upon further inspection the black and red covers for the power studs were found to have come off and the nut holding the electrical connectors were not tight which caused

heat and the airline had laid against it causing the hole.

Correction – You should be checking to make sure that the protective caps are in place. As a preventative measure you should ensure the lines do not run close to the studs and that nuts are tight.

PLEASE NOTE – If you are experiencing electrical issues such as erratic dash lights or other chassis electrical issues you may want to make sure that the studs are tight.

Thanks to Marty and the guys at Hilton CS for pointing this out!

Contact Our Service Department With Any Questions

CHITTENANGO – phone 800-962-5768 or Daryl Wallace: <u>dwallace@newyorkbussales.com</u> Brian Lamaitis: <u>blamaitis@newyorkbussales.com</u>

ROCHESTER – phone 800-463-3232 or Gary Chichester: gchichester@newyorkbussales.com

ALBANY – phone 866-867-1100 or Ben Reiling: <u>breiling@newyorkbussales.com</u>

WARRANTY – 800-962-5768 ext 237 Morgan Jenkins: <u>mjenkins@newyorkbussales.com</u>

Or Your Customer Support Representative
West

 $\label{lem:michael Panzica} \textit{Michael Panzica} - \underline{\textit{mpanzica}@\textit{newyorkbussales.com}}$

Cell 716-908-3186

Central

Jeremie "JJ" Richmond -

jjrichmond@newyorkbussales.com

Cell 315-559-3999

East

Gary Bigness – gbigness@newyorkbussales.com

Cell 845-500-3707

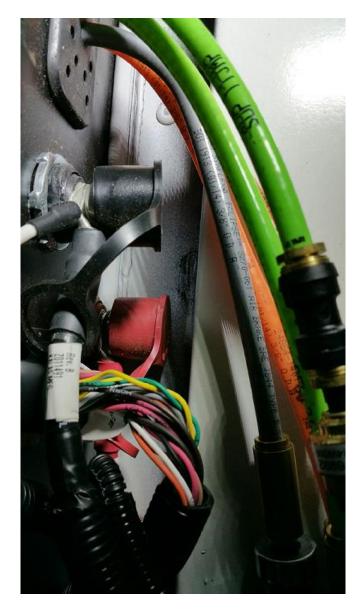


FIGURE #1



ALL of our Tech Tips can be found on the New York Bus Sales website at http://www.newyorkbussales.com/pages/bulletins.cfm
Or at the New York Head Mechanic website at http://www.nyhma.org/viewforum.php?f=2&start=0