

From your friends at New York Bus Sales

Product Effected -All American "D3"

Complaint: The wiper motors are failing prematurely

Cause: Water intrusion or electrical connection corrosion caused by Northeast road

chemicals

Correction: Seal the wiper doors against the windshield so water and road chemicals from

the windshield cannot "drip" down on the wiper motors - See Steps below

Looking at Figures #1 and #2 below you can see where water can enter the wiper motor cavity

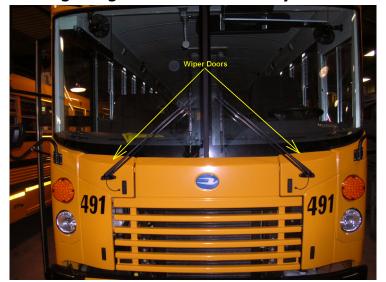






Figure #2



As you can see in Figure #3, once you open the wiper door, the electrical connections are open to water and road chemicals which run down the windshield.

Figure #3

We used a BB seal (part #00089498) which contains a metal "grip" as in Figure #4 and cut 2 lengths – 14" long as in Figure #5

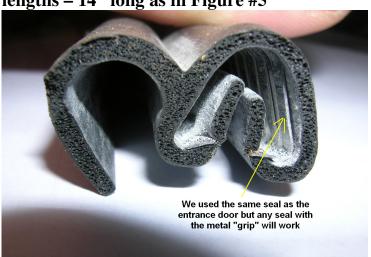




Figure #4

Figure #5

Once you have the 2 pieces of seal cut you can place them on the upper edge of each wiper door as in Figure #6. As you can see in Figure #7 the seal is tightly against the windshield.

Thanks to John and the guys from Our own Chittenango Central School For pointing this out to us!

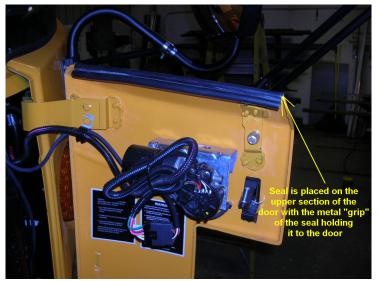


Figure #6



Figure #7



This can be checked very simply by shutting a piece of paper between the windshield and seal as in Figure #8



Contact Our Service Department With Any Questions

CHITTENANGO – phone 800-962-5768 or

Daryl Wallace: dwallace@newyorkbussales.com
Brian Lamaitis: blamaitis@newyorkbussales.com
ROCHESTER – phone 800-463-3232 or

Gary Chichester: <u>gchichester@newyorkbussales.com</u>

ALBANY – phone 866-867-1100 or

Ben Reiling: <u>breiling@newyorkbussales.com</u>
Steve Searles: <u>ssearles@newyorkbussales.com</u>

WARRANTY - 800-962-5768 ext 237

Morgan Jenkins: <u>mjenkins@newyorkbussales.com</u>