

Simultaneous Load Seat Plugs

Complaint – There are these small square black plastic pieces that we've found on the floor...see figures #1 & #2

Cause – With the implementation of the new "simultaneous load" seats there was an added "leg" which we spoke about in an earlier Service Notice and that leg is cut and added such that the top of it has an opening which was best dressed with a plastic plug.....see figures #3 & #4

Correction – Should these fall out, you can either use "Super Glue" around the sides and on the lip which meets the tubing wall or after speaking to Blue Bird concerning those places where children's fingers have a way at "prying" at things. With the plug installed and using a #10 X $\frac{1}{2}$ " self drilling screw and drill (Figures # 5 & #6), install the screw about $\frac{1}{4}$ " from the top of the tube (Figure #7)





Figure #1 Figure #2

Body Tech Tip #13-0516 Page 1



Figure #3



Figure #4

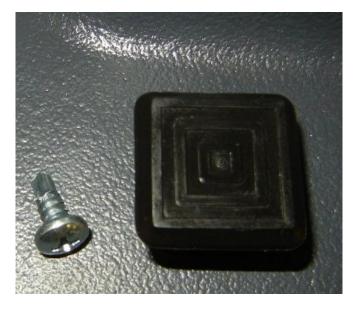


Figure #5



Figure #6

Plastic Plug Part #
00862490

Body Tech Tip #13-0516 Page 2

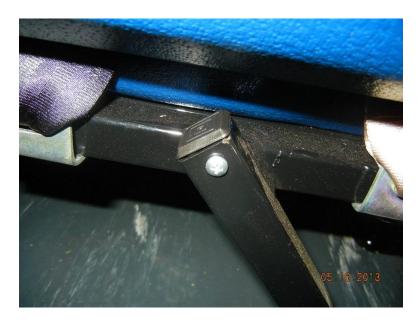


Figure #7

Contact Our Service Department With Any Questions

CHITTENANGO – phone 800-962-5768 or Daryl Wallace: <u>dwallace@newyorkbussales.com</u> Brian Lamaitis: <u>blamaitis@newyorkbussales.com</u>

ROCHESTER – phone 800-463-3232 or Gary Chichester: <u>gchichester@newyorkbussales.com</u>

ALBANY – phone 866-867-1100 or Ben Reiling: <u>breiling@newyorkbussales.com</u> Steve Searles: <u>ssearles@newyorkbussales.com</u>

WARRANTY – 800-962-5768 ext 237 Morgan Jenkins: <u>mjenkins@newyorkbussales.com</u>



ALL of our Tech Tips can be found on the New York Bus Sales website at http://www.newyorkbussales.com/pages/bulletins.cfm
Or at the New York Head Mechanic website at http://www.nyhma.org/viewforum.php?f=2&start=0