

Sleeping Child Check Feature #BUS-6 & #BUS-6T Sales Update #17-04





Doran "Sleeping Child Check" in a Microbird

A customer recently asked why after warming their units for pretrip, that the child-check alarm would sound.

The Microbird's were built with #BUS-6 (a New York Bus Sales standard feature) with the Doran Sleeping Child Check. That system would arm when the warning lights were activated as was intended. However, the listing of the feature failed to include that the system would ALSO arm after the unit had run for 10 minutes, thus causing the issue which these customers were experiencing. There is a feature #BUS-6T which is wired so ONLY the warning lights are the system.

ALL of our Service Updates can be found on the New York Bus Sales website


Or at the New York Head Mechanic website







If you have a unit with feature #BUS-6 and you do not wish to have the time active, there is a way to disable it. On the plug for the module you will find a red wire, which jumps from pin #5 to pin #14 on the plug. If you remove this wire, it will deactivate the timer. Below is a schematic of the module plug.

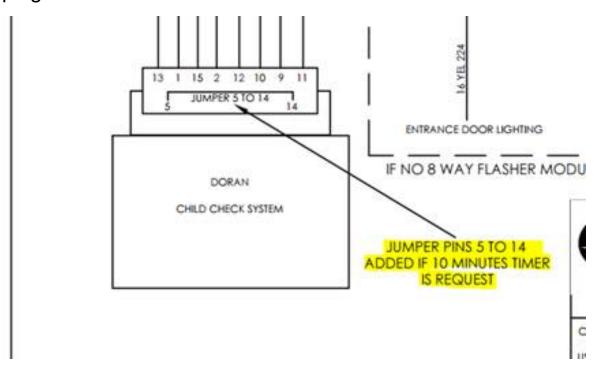

Thanks to Bob at Warwick Valley Central School for working with us to address this issue!!

ALL of our Service Updates can be found on the New York Bus Sales website

Or at the New York Head Mechanic website







CONTACT OUR SALES DEPARTMENT WITH ANY QUESTIONS

Kevin Coon kcoon@newyorkbussales.com 315-415-6570

Bill Daigler wdaigler@newyorkbussales.com 716-713-9852

George Darling gdarling@newyorkbussales.com 315-263-6141 Jeremy Johnston jjohnston2@newyorkbussales.com 585-233-3768

Bill Lyons II wlyons2@newyorkbussales.com 518-275-2816

Jeremie (JJ) Richmond jrichmond@newyorkbussales.com 315-559-3999

ALL of our Service Updates can be found on the New York Bus Sales website

Or at the New York Head Mechanic website





